
3.3.6 Fitting equipment on the robot (robot dimensions)

Continued

Tool flange standard





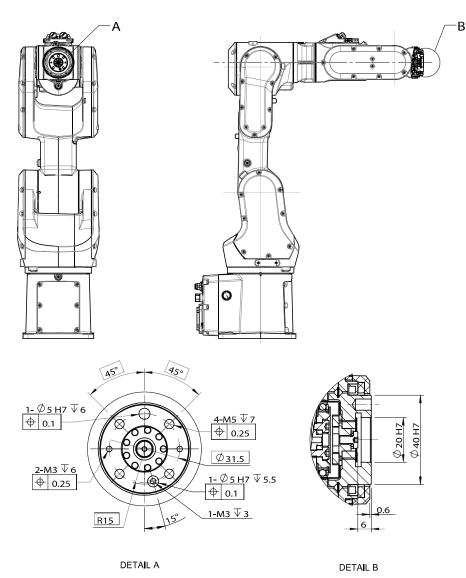

xx2300001052



CAUTION

To calibrate the axis 6, the notch on the wrist must be aligned with the marked pin hole on the tool flange. Before installing a tool on the tool flange, make sure a visible mark has been made to the tool at the corresponding position.

For details about the synchronization mark, see *Synchronization marks and synchronization position for axes on page 549*.

Fastener quality

When fitting tools on the tool flange, only use screws with quality 12.9. For other equipment use suitable screws and tightening torque for your application.